

# Manhole Inspection Summary

Manhole # S11GG\_046MH

Printed On: 4/22/2009

Page 1 of 4

**Inspection** ☐ Is Incomplete Rating: **2) Good**

Record Plat: **11GG** Node: **046** Status: **Found**

Insp Date: **1/13/09 2:47 PM**

Incomplete Comments

Crew: **ads1**  
Inspector: **ADS1**  
Firm: **ADS**

**Location** Address: **3000 BAKER ST**

Cross Street: **BLOOMINGDALE RD**

**Manhole** Type: **Junction**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

**Cover**

Shape: **Circular**

Diameter: **25.** (in.) Length: (in.) Dist A/B Grade: **0** (in.)  
**75**

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame**

Offset: **3** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment**

☐ Exists Material: **Brick**

☐ Parged Height: **4** (in.)

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☒ **Loose Brick** ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel**

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel**

Material: **Brick**

☐ Parged

Shape: **Circular** Diameter: **40** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Bench**

☒ Exists Material: **Brick**

☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel**

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps**

Count: **7** Missing: **0** ☒ **Corroded**

**Surcharge**

☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

# Manhole Inspection Summary

Manhole # S11GG\_046MH

Printed On: 4/22/2009

Page 2 of 4

Location View



Top View



CORRODED STEPS

Defect 1



FRAME OFFSET

## Manhole Inspection Summary

Manhole # S11GG\_046MH

Printed On: 4/22/2009

Page 3 of 4

8 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



LOTS OF GREASE ON WALL OF PIPE

Pipe Height: (in.) Direct  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **11.86** (ft.) Flow Characteristics: **Slow**  
Deposits: ☐ None ☐ Mud ☐ Sludge ☐ Debris ☒ **Grease**  
Silt Depth: **1** (in.) Deposits Extent: **Medium**  
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer  
Pipe In @ 4 O'Clock

4 O'Clock Inflow



LOOKS LIKE MORE GREASE IN CHANNEL.

Pipe Height: (in.) Direct  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **11.85** (ft.) Flow Characteristics: **None**  
Deposits: ☐ None ☐ Mud ☐ Sludge ☐ Debris ☒ **Grease**  
Silt Depth: **0** (in.) Deposits Extent: **Medium**  
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Dead End**

☐ Possible Illicit Connection

## Manhole Inspection Summary


Manhole # S11GG\_046MH

Printed On: 4/22/2009

Page 4 of 4

8 in. Circular Gravity Sewer  
Pipe In @ 8 O'Clock

8 O'Clock Inflow

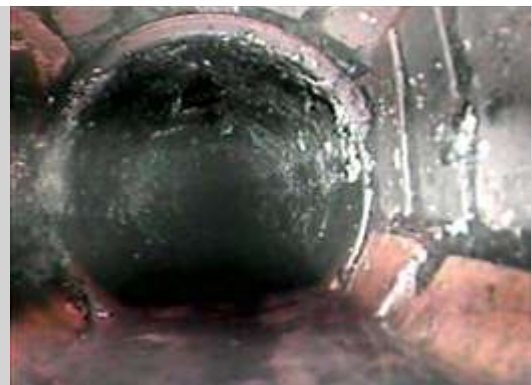

LOTS OF GREASE IN PIPE.

Pipe Height: (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **11.96** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☐ Mud ☐ Sludge ☐ Debris ☒ **Grease**

Silt Depth: **1** (in.) Deposits Extent: **Light**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection